

## RC-85/96 Repeater Controller V4.2 Software Changes

The following changes have been made to V4.0/4.1 software to correct several problems:

✤ FC-900 band swapping is handled properly.

 Spare Audio passes properly without the Link COS needing to be high.

☞ Only the Forced CW ID will be generated when Spare Audio is up.

 The programmed ringout timer applies properly to Reverse Patch Mode 1.

✤ The digit 1 is not allowed as the first digit of Custom Hangup Codes. This allows (for example) \*1xx to be accepted as a User Autodial Bank 1 Activate, instead of a Custom Hangup Code define command.

RC-85 – You may install the IC EPROM at location U28 (27011).

RC-96 – You may install the two IC EPROMs at locations U29 (27513) and U34 (2764).

We would appreciate receiving the old EPROMs back in the selfaddressed stamped box. If you have any questions, please call our Technical Support Line at (408) 727-3414. Thank you.

## Archive of K6COP WR6COP Repeater